

Intercomparison of Condensation Particle Counter

Project No.: CPC-2016-1-2

Basic information:

Location of the quality assurance: TROPOS, lab: 130

Delivery date: -

Setup in the laboratory: January 25, 2016

Comparison period: January 26, 2016

Principal Investigator	Home Institution	Participant	Instrument
Jean-Philippe Putaud	JRC Via E. Fermi 2749 21027 Ispra Italy	Sebastiao Martins dos Santos	IT-JRC Ispra TSI CPC Model 3772 # 3772133103

TROPOS Reference Instrument: Electrometer: TSI model 3068B
70838596

Additional Equipment:

- Bubble flow meter 'Gilibrator', Gilian (Sensidyne)

Summary of Intercomparison:

Pre-status:

The TSI CPC Model 3772 was in good condition.

Final status:

The TSI CPC Model 3772 passed the quality standards of ACTRIS and GAW.

On January 26, 2016, the IT-JRC Ispra 3772 #3772133103 participated in the TROPOS ACTRIS-2 CPC-Workshop.

1. Status of the wick: The wick was clean.
2. Status of the CPC: The CPC was working properly.
3. Final CPC-Workshop: The TSI CPC Model 3772 reached 97% efficiency at 30 nm. The Dp50 is at 8.4 nm. The CPC efficiency curve corresponds to the standard.

final-status: 26.01.2016, Tuesday

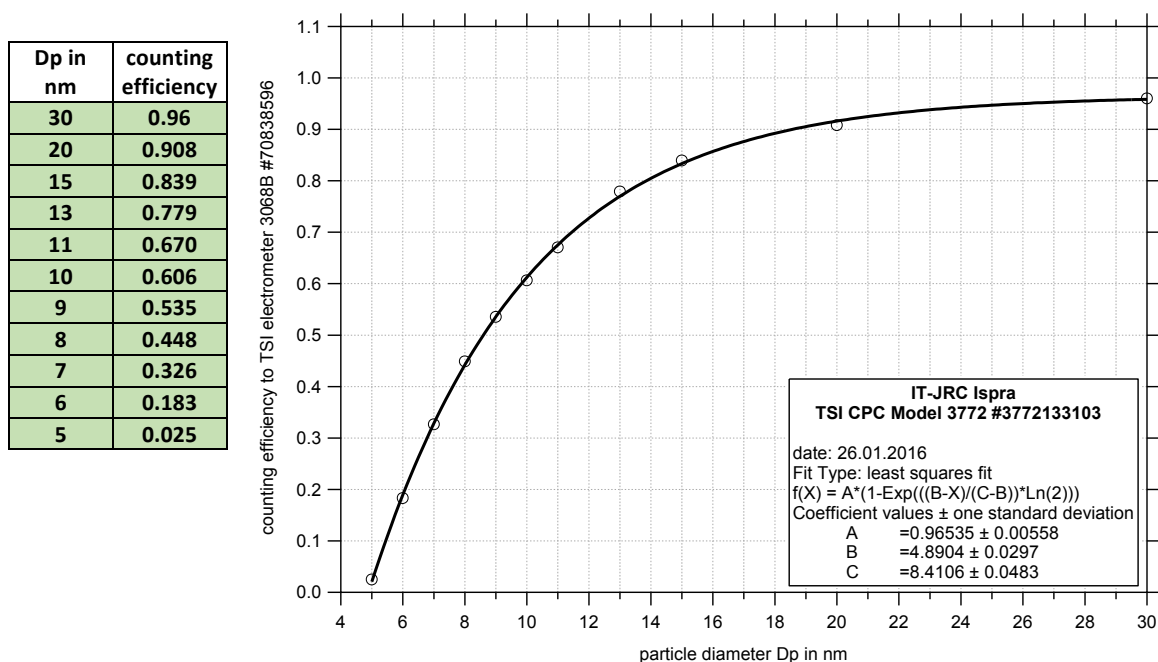


Figure 01: CPC efficiency curve. Based on Electrometer TSI 3068B. Serial number: 70838596